



REFLECTED CEILING PLAN

1/4" = 1'-0"



REHABILITATION NOTES:

CLEANER BY PROSOCO

R1 - REMOVE ALL LOOSE & SCALING MATERIAL. PATCH & REPAIR ALL DAMAGED PLASTER. PRIME & 2 COATS OF

R2 - REMOVE EXIST. FRAMED UNIT. REPAIR DAMAGED WOOD W/ APPROVED EPOXY WD REHABILITATION KIT. PRIME & 2 COATS OF APPROVED PAINT R3 - REMOVE ALL LOOSE & SCALING MATERIAL. REHBILITATE

DAMAGED PLASTER DETAILING ON CORNICE. PRIME & 2 COATS OF APPROVED PAINT

R4 - REPAIR/REHABILITATE DAMAGED WOOD TRIM. REMOVAL ALL LOOSE & SCALING MATERIAL PRIME & 2 COATS OF APPROVED PAINT. R5 - REMOVE LOOSE & ABANDONED ELECTRICAL SURFACE

MOLDING R6 - REMOVE ABANDONED MECHANICAL STEAM PIPING -PATCH HOLES IN WALLS & FLOORS

R7 - REBUILD EXIST. DOOR CLOSER R8 - INSTALL WALL MOUNTED DOOR STOP W/ HOOK HOLD

OPEN FEATURE R9 - CLEAN EXIST. TILE SURFACE W/ APPROVED REHABILITATION CLEANER - PROTECT AJOINING PLASTER &

MOOD SURFACES. R10 - REMOVED & REHABILIATE EXIST. WOOD DOOR. REHAB EXIST. PUSH/PULL HARDWARE & HOLD OPEN FEATURES. R11 - REPAIR CRACK IN EXIST. PLASTER, REMOVE ALL LOOSE \$ SCALING MATERIAL PRIME \$ 2 COATS OF APPROVED PAINT. R12 - CLEAN TERRA COTTA MASONRY W/ EK RESTORATION

R13 - INSTALL NEW WALL MOUNTED DOOR STOP/HOLD-OPEN M/IN AREA INDICATED

R14 - INSTALL NEW TEMPERED GLASS W/IN EXIST. POSTER DISPLAY FRAME

R15 - INSTALL NEW LED WALL WASHER FIXTURE W/IN POSTER DISPLAY FRAME R16 - REMOVE EXIST. FLOOR COVERING & REPLACE W/ NEW


FLR. COVERING R17 - REMOVE EXIST. CLG. MTD. FAN & ASSOCIATE ELEC. MIRING – MAKE SAFE

R18 - REHAB EXIST. SUSP. LIGHT FIXTURE W/ NEW LED BULB & NECESSARY DRIVER MODIFICATIONS. R19 - REMOVE EXIST. TELECOM BOX & ASSOC. EXPOSED

R20 - REMOVE ALL LOOSE & SCALING MATERIAL FROM EXIST. CABINETRY - PRIME & 2 COATS OF PAINT R21 - REHABILITATE EXIST. WALL MTD. LIGHT FIXTURE.

REPLACE EXIST. DAMAGED GLASS & INSTALL NEW LED LIGHTING KIT R22 - RAKE OUT LOOSE & RECESSED MORTAR JOINTS &


REPOINT W/ HISTORIC MORTAR R23 - SEAL JT. W/ APPROVED SEALANT

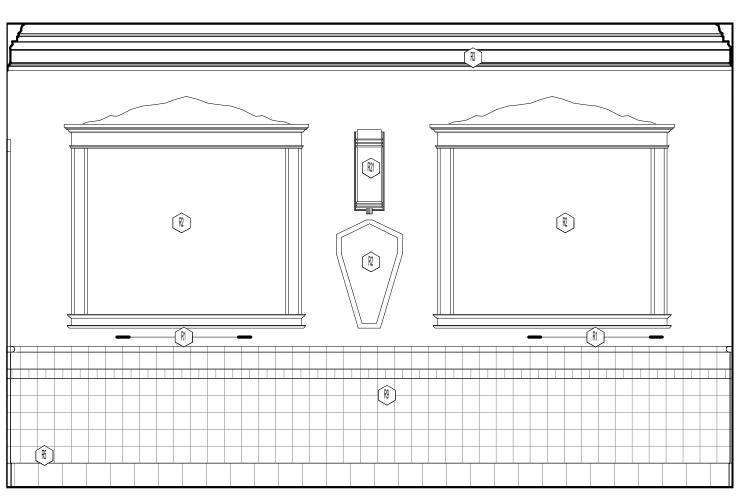

EAST LOBBY ELEV. 1/2" = 1'-0"



NORTH LOBBY ELEV. 1/2" = 1'-0"

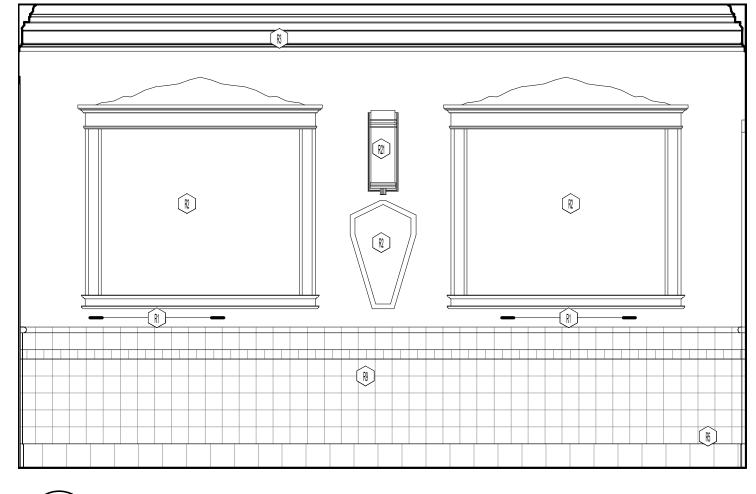

MEST LOBBY ELEV.



SOUTH LOBBY ELEV.



Architect Heckman & Associates, P.A. 107 1/2 N. Penn. Ave. P.O. Box 1314 Independence, KS 67301 Phone: (620) 331-6171 Fax: (620) 331-6172 E-mail: sclapp_heckman@sbcglobal.net jheckman_heckman@sbcglobal.net

COPYRIGHT NOTE:

Copyright Heckman & Assoc. P.A. 2011 Federal Copyright law prohibits any duplication of this document inpart or inwhole without express written consent from Heckman & Associates, P.A. - 2011

REVISIONS		
No	Description	Date

MIDLAND THEATER **FOUNDATION**


MIDLAND THEATER LOBBY REHABILITATION


PLANS, ELEVATIONS & NOTES


Sheet	Α1
Checked by	Checker
Drawn by	Author
Date	Issue Date
Project number	H&A1533

As indicated



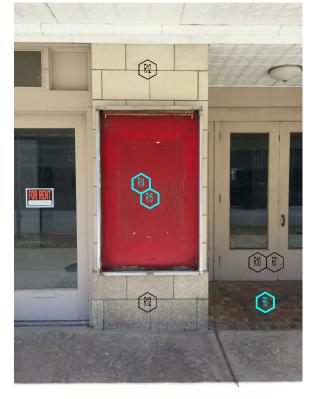


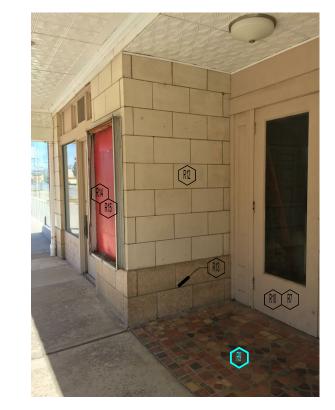

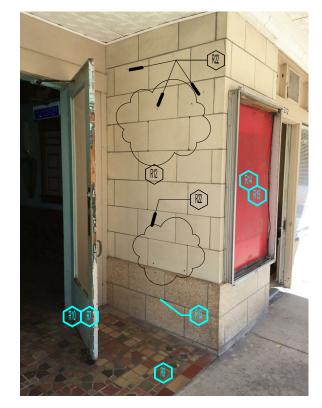





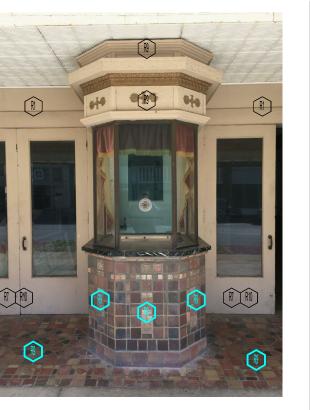



SOUTH EXTERIOR ELEVATION

TYP. EXT. POSTER DISPLAY

WEST ENTRANCE DOOR

EAST ENTRANCE DOOR

EAST ENTRANCE DOOR DOOR STOP LOC.

SOUTH EXTERIOR ELEVATION

TICKET BOOTH SOUTH ELEV.

















Heckman & Associates, P.A. 107 1/2 N. Penn. Ave. P.O. Box 1314 Independence, KS 67301 Phone: (620) 331-6171 Fax: (620) 331-6172

E-mail: sclapp_heckman@sbcglobal.net jheckman_heckman@sbcglobal.net

Architect

TICKET BOOTH SE ELEV.

TICKET BOOTH SE ELEV LOW

TICKET BOOTH SE ELEV HIGH

TICKET BOOTH SW ELEV

TICKET BOOTH MEST ELEV LOW

TICKET BOOTH WEST ELEV HIGH

TICKET BOOTH INT. ELEV.

TICKET BOOTH CLG. ELEV.



TICKET BOOTH CLG.



LOBBY EAST ELEV.



LOBBY NORTH INT. ELEV.



LOBBY NORTH INT. ELEV. 2



LOBBY NORTH INT. ELEV. 2 @ CEILING INTERSECTION



MEST INT. LOBBY DOORS




MIDDLE INT. LOBBY DOORS



EAST INT. LOBBY DOORS



MEST INT. LOBBY CEILING

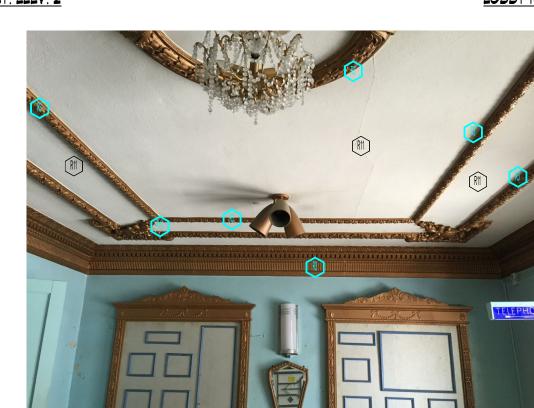

EAST INT. LOBBY CEILING

REHABILITATION NOTES:

OPEN FEATURE

R1 - REMOVE ALL LOOSE & SCALING MATERIAL. PATCH & REPAIR ALL DAMAGED PLASTER. PRIME & 2 COATS OF APPROVED PAINT

R2 - REMOVE EXIST. FRAMED UNIT. REPAIR DAMAGED WOOD W/ APPROVED EPOXY WD REHABILITATION KIT. PRIME & 2 COATS OF APPROVED PAINT R3 - REMOVE ALL LOOSE & SCALING MATERIAL. REHBILITATE

DAMAGED PLASTER DETAILING ON CORNICE. PRIME & 2 COATS OF APPROVED PAINT R4 - REPAIR/REHABILITATE DAMAGED WOOD TRIM. REMOVAL ALL LOOSE & SCALING MATERIAL PRIME & 2 COATS

OF APPROVED PAINT. R5 - REMOVE LOOSE & ABANDONED ELECTRICAL SURFACE MOLDING

PATCH HOLES IN WALLS & FLOORS R7 - REBUILD EXIST. DOOR CLOSER R8 - INSTALL WALL MOUNTED DOOR STOP W/ HOOK HOLD

R6 - REMOVE ABANDONED MECHANICAL STEAM PIPING -

R9 - CLEAN EXIST. TILE SURFACE W/ APPROVED REHABILITATION CLEANER - PROTECT AJOINING PLASTER & MOOD SURFACES. R10 - REMOVED & REHABILIATE EXIST. WOOD DOOR. REHAB

EXIST. PUSH/PULL HARDWARE & HOLD OPEN FEATURES. R11 - REPAIR CRACK IN EXIST. PLASTER, REMOVE ALL LOOSE & SCALING MATERIAL PRIME & 2 COATS OF APPROVED PAINT. R12 - CLEAN TERRA COTTA MASONRY W/ EK RESTORATION CLEANER BY PROSOCO

R13 - INSTALL NEW MALL MOUNTED DOOR STOP/HOLD-OPEN M/IN AREA INDICATED

R14 - INSTALL NEW TEMPERED GLASS W/IN EXIST. POSTER DISPLAY FRAME R15 - INSTALL NEW LED WALL WASHER FIXTURE W/IN POSTER

DISPLAY FRAME R16 - REMOVE EXIST. FLOOR COVERING & REPLACE W/ NEW FLR. COVERING

R17 - REMOVE EXIST. CLG. MTD. FAN & ASSOCIATE ELEC. MIRING – MAKE SAFE R18 - REHAB EXIST. SUSP. LIGHT FIXTURE W/ NEW LED BULB & NECESSARY DRIVER MODIFICATIONS. R19 - REMOVE EXIST. TELECOM BOX & ASSOC. EXPOSED

R20 - REMOVE ALL LOOSE & SCALING MATERIAL FROM EXIST. CABINETRY - PRIME & 2 COATS OF PAINT R21 - REHABILITATE EXIST. WALL MTD. LIGHT FIXTURE. REPLACE EXIST. DAMAGED GLASS & INSTALL NEW LED

LIGHTING KIT R22 - RAKE OUT LOOSE & RECESSED MORTAR JOINTS & REPOINT W/ HISTORIC MORTAR R23 - SEAL JT. W/ APPROVED SEALANT

COPYRIGHT NOTE:

Copyright Heckman & Assoc. P.A. 2011 Federal Copyright law prohibits any duplication of this document inpart or inwhole without express written consent from Heckman & Associates, P.A. - 2011

No	Description	Dat

MIDLAND THEATER FOUNDATION

MIDLAND THEATER LOBBY REHABILITATION

PHOTO DETAILS & NOTES

H&A1533 Project number Issue Date SAC Drawn by Checked by JEH

